



**Product Name:** FC-6

<b>Current Version:</b>	<b>Ver.Type</b>	<b>Ver No.</b>	<b>Date</b>
	<b>Firmware</b>	2.0.43	February 2017
	<b>Software</b>	–	–
	<b>Web</b>	–	–
	<b>Hardware</b>	–	–

**RN Date:** February 2017

**Reference:** 11838

### Kramer Product Affected:

<b>Product Name</b>	<b>Minimum FW Version for Upgrade</b>	<b>Recommended for All Units</b>	<b>Only if Added Features are Required</b>
FC-6	Any	Yes	N/A

### Technical Notes:

- Support for new hardware components was added.
- New firmware is compatible both with new and old hardware configurations.

### Codependency with Other Products and Software:

- There is no codependency with other products or software.



**KRAMER ELECTRONICS, Ltd.**

E-mail: [info@kramerel.com](mailto:info@kramerel.com)

Web: [www.kramerelectronics.com](http://www.kramerelectronics.com)



**Product Name:** FC-6

**Current Version:**

Ver.Type	Ver No.	Date
Firmware	2.13.33607	January 2017
Software	–	–
Web	–	–
Hardware	–	–

**RN Date:** January 2017

**Reference:** 11838

The following changes were made in this version:

### Modifications:

QC ID	Description
	Support for new hardware components
	Made compatible with both new and old hardware configurations

### Bugs to be Fixed in Future Version:

QC ID	Description
1982	When 'Use Time Server' is on 'Device time' and 'Device date' is not disabled, and When 'Use Time Server' is off -->'Time server address' and 'Sync every date at' are not disabled
4998	P3K log level command appears
5002	P3K Name-change command faulty
5003	Incorrect response for P3K Mach-num command
5004	Unable to set a password that includes letters by P3K Pass command
5005	Incorrect response for P3K Factory command
5038	WEB: Scroll option works improperly
5039	WEB: Unrecognized error message upon tunneling creation
5226	Can't configure baud rate 1200-4800
7354	WEB GUI: IR Learning appends an extra "space" char to command string
8557	The wrong device serial mode is presented on web page
9151	There is wrong time validation
9156	Different behavior in model command after factory reset



**KRAMER ELECTRONICS, Ltd.**

E-mail: [info@kramerel.com](mailto:info@kramerel.com)

Web: [www.kramerelectronics.com](http://www.kramerelectronics.com)



## Known Limitations (including compatibility limitations):

QC ID	Description
1349	Web: UI wrong response with parallel operations of multiple users
4999	WEB:No FW upgrade option
5024	WEB:No Factory reset option
2051	According to MRD need to have: 2x3 Terminal Block RS232 Connectors. Actually there is 1x6 block
5825	Unable to perform FW upgrade for VP-771/773 devices
5845	WEB Log tab – Serial transferred data is not shown
5846	WEB GUI: "Discard changes" warning message is not shown when changing the 'Send replies to new client by default' button
5915	It's possible to set TCP port value less than 1024
6615	No IR learning LED exists
6627	Device control operation is ceased during IR learning process
6841	IE11: Save Configuration process is not supported
9097	UDP port 50000 is always accessible

**Preceding Version:** F - 2.8.30665



**KRAMER ELECTRONICS, Ltd.**

E-mail: [info@kramerel.com](mailto:info@kramerel.com)

Web: [www.kramerelectronics.com](http://www.kramerelectronics.com)



**Product Name:** FC-6

<b>Preceding Version:</b>	Ver.Type	Ver No.	Date
	Firmware	2.8.30665	September 2016
	Software	–	–
	Web	–	–
	Hardware	–	–

**RN Date:** November 2016

**Reference:** 9499

This is a release note for a new product. For a list of new product features see:

<http://www.kramerav.com/manual/FC-6>

### Bugs to be Fixed in Future Version:

QC ID	Description
8550	The TCP keep-alive value should be between 0 to 360
9097	UDP port 50000 is always accessible even when changing to another port

### Known Limitations (including compatibility limitations):

QC ID	Description
	None listed

**Preceding Version:** N/A



**KRAMER ELECTRONICS, Ltd.**

E-mail: [info@kramerel.com](mailto:info@kramerel.com)

Web: [www.kramerelectronics.com](http://www.kramerelectronics.com)