



Release Notes

Product Name: VP-475UX

Current Version: Type

Туре	Number	Date
Firmware	R1.8.50238	November 2018
Software	_	_
Web	_	_
Hardware	_	_

RN Date: November 29, 2018

Reference: 13052

Kramer Product Affected:

Product Name	Minimum FW Version for Upgrade	Recommended for All Units	Only if Added Features are Required
VP-475UX	N/A	N/A	N/A

Technical Notes:

This is a release note for a new product.

Codependency with Other Products and Software:

• There is no codependency with other products or software.





Release Notes

Product Name: VP-475UX

Current Version: Type

Туре	Number	Date
Firmware	R1.8.50238	November 2018
Software	ı	_
Web	ı	_
Hardware	_	_

RN Date: November 29, 2018

Reference: 13052

This is a release note for a new product. For a list of new product features see:

www.kramerav.com/manual/VP-475UX

Bugs to Fix in Future Versions:

QC ID	Deferred Bug Description
13537	Error when sending the Protocol 30000 SECUR? command via local USB connection (the response via TCP and UDP is correct).
13776	Incorrect behavior on some IP-address gateway set scenarios.
13778	Inconsistent behavior of LOGIN/LOGOUT with TCP/UDP and USB.
13787	Reset button (rear panel) doesn't work.
14650	In SD resolution, SDI loop measured signal performance could be improved.
14651	In SD resolution, audio AES R output should not be connected as noise might be heard.
14759	Following power-up, audio extraction is not auto-activated until HDMI sink is connected.

Known Limitations (including compatibility limitations):

QC ID	Limitation Description
13575	Using IPAD Safari, the Full Screen button is missing.
13842, 13844	When Web-UI FW upgrade fails with some Edge browser versions, device gets stuck. Recommended workaround: use Chrome for web-UI FW upgrade.
13836	SD input resolution may experience image quality issues with certain image patterns.

Preceding Version: N/A



KRAMER ELECTRONICS, Ltd.

E-mail: <u>info@kramerav.com</u>
Web: <u>www.kramerav.com</u>