

Release Notes

Product Name: VS-622DT

Current Version:

Ver.Type	Ver No.	Date
Firmware	2.0.48695	July 2018
Software	–	–
Web	–	–
Hardware	–	–

RN Date: July 2018

Reference: 14202

Kramer Product Affected:

Product Name	Minimum FW Version for Upgrade	Recommended for All Units	Only if Added Features are Required
VS-622DT	Any	Yes	Yes

Technical Notes:

- FW 2.0.48695 fixes the delay of analog audio following matrix switching.

Codependency with Other Products and Software:

- There is no codependency with other products or software.



KRAMER ELECTRONICS, Ltd.

E-mail: info@kramerav.com

Web: www.kramerav.com

Release Notes

Product Name: VS-622DT

Current Version:

Ver.Type	Ver No.	Date
Firmware	2.0.48695	July 2018
Software	–	–
Web	–	–
Hardware	–	–

RN Date: July 2018

Reference: 14202

The following changes were made in this version:

Modifications:

QC ID	Modification Description
	Delay of analog audio following matrix switching

Bugs to Fix in Future Versions:

QC ID	Deferred Bug Description
11890	Internal Pattern Generator output may provide unstable video source for up to 1 sec after inputs connection or disconnection.
11897	NET-GATE protocol 3K command error response for out of range value is 'Err01' instead of expected 'Err03'.
12003	FW upgrade through embedded web page is supported through Chrome, IE and Firefox. Using Safari for this operation may cause a FW programming error that requires reprogramming through K-Upload only.
12504	Protocol response for Step-In Client button-press does not comply to P3K definition.
12514	Routing Preset Load and Save functions through embedded web page is supported through Chrome, IE and Firefox. These buttons do not appear in Safari browser.
12517	Time server status may appear unreachable after setting it via the web page. Actually, the time server is reachable.
12542	P3K NET-DHCP 1 command may rarely reply Err 031. In case that occurs, please re-power and retry the command for successful operation.
12544	The configuration of GPIO should be done through embedded web page and not through K-Config3.
13368	Android tablet preferred screen resolution is 1280x800, scale ratio 1:1.
14242	Audio switching web page: Audio Speaker-Out selector does not indicate the change when Audio Swap has been toggled.



KRAMER ELECTRONICS, Ltd.

E-mail: info@kramerav.com

Web: www.kramerav.com

Release Notes

Known Limitations (including compatibility limitations):

QC ID	Limitation Description
	None listed

Preceding Version: F - 2.0.46852_190318



KRAMER ELECTRONICS, Ltd.

E-mail: info@kramerav.com

Web: www.kramerav.com

Release Notes History

Product Name: VS-622DT

Current Version:

Ver.Type	Ver No.	Date
Firmware	2.0.46852_190318	May 2018
Software	–	–
Web	V3.2.12	May 2018
Hardware	–	–

RN Date: May 2018

Reference: 12259

Kramer Product Affected:

Product Name	Minimum FW Version for Upgrade	Recommended for All Units	Only if Added Features are Required
VS-622DT	N/A	N/A	N/A

Technical Notes:

- This is a release note for a new product.

Codependency with Other Products and Software:

- There is no codependency with other products or software.



KRAMER ELECTRONICS, Ltd.

E-mail: info@kramerav.com

Web: www.kramerav.com

Release Notes History

Product Name: VS-622DT

Current Version:

Ver.Type	Ver No.	Date
Firmware	2.0.46852_190318	May 2018
Software	–	–
Web	V3.2.12	May 2018
Hardware	–	–

RN Date: May 2018

Reference: 12259

This is a release note for a new product. For a list of new product features see:

www.kramerav.com/manual/VS-622DT

Bugs to Fix in Future Versions:

QC ID	Deferred Bug Description
11890	Internal Pattern Generator output may provide unstable video source for up to 1 sec after inputs connection or disconnection.
11897	NET-GATE protocol 3K command error response for out of range value is 'Err01' instead of expected 'Err03'.
12003	FW upgrade through embedded web page is supported through Chrome, IE and Firefox. Using Safari for this operation may cause a FW programming error that requires reprogramming through K-Upload only.
12504	Protocol response for Step-In Client button-press does not comply to P3K definition.
12514	Routing Preset Load and Save functions through embedded web page is supported through Chrome, IE and Firefox. These buttons do not appear in Safari browser.
12517	Time server status may appear unreachable after setting it via the web page. Actually, the time server is reachable.
12542	P3K NET-DHCP 1 command may rarely reply Err 031. In case that occurs, please re-power and retry the command for successful operation.
12544	The configuration of GPIO should be done through embedded web page and not through K-Config3.
13368	Android tablet preferred screen resolution is 1280x800, scale ratio 1:1.

Known Limitations (including compatibility limitations):

QC ID	Limitation Description
	None listed.

Preceding Version: N/A



KRAMER ELECTRONICS, Ltd.

E-mail: info@kramerav.com

Web: www.kramerav.com