

**TRUST
THE
ORIGINAL**

BNC Connectors

**Cable to Connector &
Connector to Cable Guide**





NEUTRIK®

Content **Page**

Cable to Connector Guide	4
Argosy Image	4
Belden	4
CAE	4
Canare	5
Canford	5
Clark	5
Commscope	5
Cordial	5
Draka Multimedia Cable	6
Direct Cable	6
Kabeltronic	6
KLOTZ	6
Nexans	7
Percon	7
Proel	7
RG	7
Sommer	7
Suhner	8
Tesca	8
Van Damme	8
Others	8
Connector to Cable Guide	10
rearTWIST HD & UHD	10
rearTWIST Tiny	10
Cable Jack Tiny & Panel Version	11

BNC Connectors

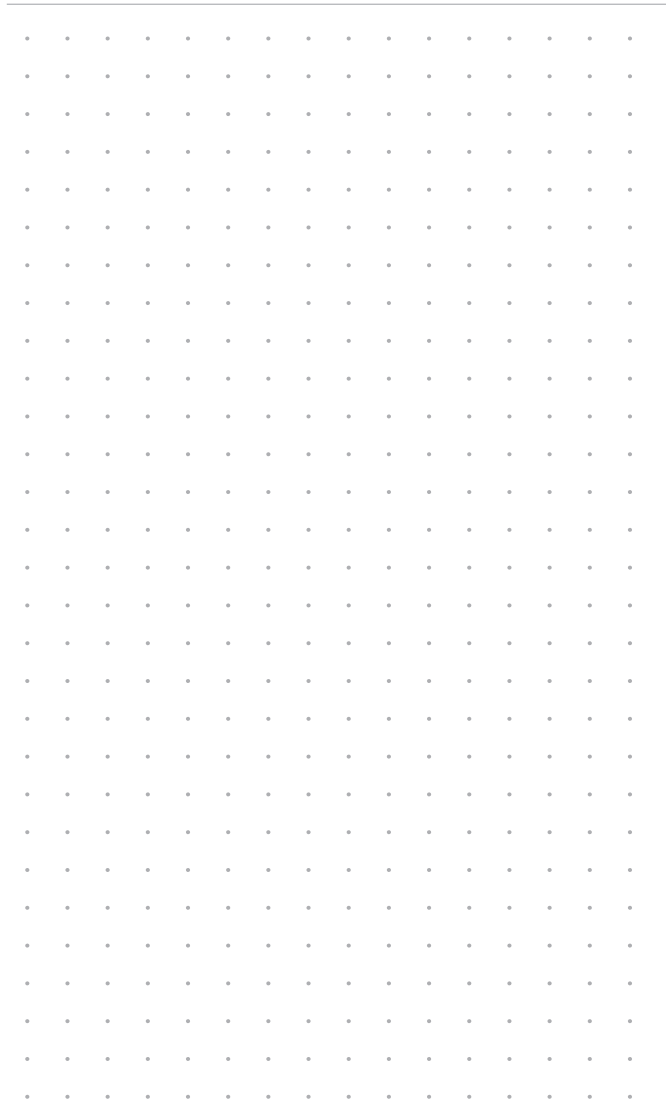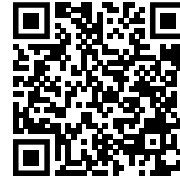

rearTWIST UHD Connector



rearTWIST HD



HD BNC Cable Jacks Panel Version



ACCESSORIES

Colour Coded Accessories and Seals

Assembly Tools



Example



Example



	rearTWIST UHD	rearTWIST HD	rearTWIST HD Tiny	Cable Jack & Panel	Pin Crimp in mm		Hex Crimp in mm	Stripping Tool			
					UHD	HD		CS-BNC-RT	CS-BNC-LCS	CS-BNC-LCV	+ CS-BNC-TCI

■ Argosy Image

Argosy Image 360	NBNC75BFG7X	NBNC75BFG7			1.07	1.6	5.00	●	-	-	-
Argosy Image 720	NBNC75BLP9X	NBNC75BLP9			1.07	1.6	6.47	●	-	-	-
Argosy Image 1000	NBNC75BUU11X	NBNC75BUU11		NBNB75GUU11	1.07	1.6	7.36	●	-	-	-

■ Belden

Belden 1277R, 1278R, 1279R			NBTC75BNN5				1.6	4.53	●	-	-	●
Belden 1406B, 1407B, 1417B			NBTC75BVV5				1.6	5.00	●	-	-	●
Belden 1426A, 1505A (ANH), 4505R	NBNC75BLP9X	NBNC75BLP9		NBNB75GLP9	1.07	1.6	6.47	●	-	-	-	
Belden 1505F	NBNC75BJP9X	NBNC75BJP9			1.07	1.6	6.47	●	-	-	-	
Belden 1506A		NBNC75BIJ9					1.6	5.41	●	-	-	-
Belden 1520A, 1521A, 1522A, 179DT			NBTC75BFI4	NBTB75CFI4			1.6	4.06	●	-	-	●
Belden 1694A (ANH, DNH)	NBNC75BTU11X	NBNC75BTU11			1.07	1.6	7.36	●	-	-	-	
Belden 1694F		NBNC75BRU11					1.6	7.36	●	-	-	-
Belden 1695A	NBNC75BQP11X	NBNC75BQP11			1.07	1.6	6.47	●	-	-	-	
Belden 1794A		NBNC75BZV14					1.6	8.23	●	-	-	-
Belden 1855A	NBNC75BDD6X	NBNC75BDD6			1.07	1.6	4.53	●	-	-	-	
Belden 1855EFN	NBNC75BFG7X	NBNC75BFG7			1.07	1.6	5.00	●	-	-	-	
Belden 1865A			NBTC75BXX6				1.6	5.00	●	-	-	●
Belden 1855ENH	NBNC75BFG7X	NBNC75BFG7			1.07	1.6	5.00	●	-	-	-	
Belden 4505P		NBNC75BIJ9					1.6	5.41	●	-	-	-
Belden 4505R	NBNC75BLP9X	NBNC75BLP9			1.07	1.6	6.47	●	-	-	-	
Belden 4694P	NBNC75BQP11X	NBNC75BQP11			1.07	1.6	6.47	●	-	-	-	
Belden 4694R	NBNC75BTU11X	NBNC75BTU11			1.07	1.6	7.36	●	-	-	-	
Belden 4855P	NBNC75BDD6X	NBNC75BDD6			1.07	1.6	4.53	●	-	-	-	
Belden 4855R	NBNC75BDD6X	NBNC75BDD6			1.07	1.6	4.53	●	-	-	●	
Belden 7731A (ANH)		NBNC75BVZ17					1.8	10.00	-	-	●	-
Belden 8218			NBTC75BXX5				1.6	5.00	●	-	-	●
Belden 8241	NBNC75BLP7X	NBNC75BLP7			1.07	1.6	6.47	●	-	-	-	
Belden 8241F	NBNC75BLP9X	NBNC75BLP9		NBNB75GLP9	1.07	1.6	6.47	●	-	-	-	
Belden 8281		NBNC75BXY9					1.6	8.23	●	-	-	-
Belden 8281F		NBNC75BY9					1.6	8.23	●	-	-	-
Belden 9221			NBTC75BLI4				1.6	4.06	●	-	-	●
Belden 70078CH HDTV			NBTC75BNN5	NBTB75CINN5			1.6	4.53	●	-	-	●
Belden 70080, 70080NH	NBNC75BFG7X	NBNC75BFG7			1.07	1.6	5.00	●	-	-	-	
Belden 70081, 70081NH	NBNC75BLP9X	NBNC75BLP9			1.07	1.6	6.47	●	-	-	-	
Belden 70082, 70082CH & 70082NH	NBNC75BTU11X	NBNC75BTU11			1.07	1.6	7.36	●	-	-	-	
	NBNC75BTUP11X				1.07		7.06	●	-	-	-	

■ CAE

CAE MC75			NBTC75BLI5	NBTB75CLI5			1.6	4.06	●	-	-	●
CAE MC75.39			NBTC75BVX6				1.6	5.00	●	-	-	●
CAE KX6A	NBNC75BLP7X	NBNC75BLP7			1.07	1.6	6.47	●	-	-	-	
CAE VCB75		NBNC75BNP9					1.6	6.47	●	-	-	-
CAE VCB 100		NBNC75BXU13					1.6	7.36	●	-	-	-
CAE HD1250FLEX		NBNC75BXU13					1.6	7.01	●	-	-	-
CAE HD10460LSZH		NBNC75BTS11					1.6	7.01	●	-	-	-
CAE HD0628LSZH	NBNC75BFG7X	NBNC75BFG7			1.07	1.6	5.00	●	-	-	-	
CAE HD08370LSZH	NBNC75BLP9X	NBNC75BLP9			1.07	1.6	6.47	●	-	-	-	
CAE HD16720LSZH		NBNC75BVZ17					1.8	10.00	-	-	●	-



	rearTWIST	rearTWIST	rearTWIST	Cable Jack & Panel	Pin Crimp		Hex Crimp	Stripping				
	UHD	HD	HD Tiny		in mm	in mm	in mm	Tool				
					UHD	HD		CS-BNC-RT	CS-BNC-LCS	CS-BNC-LCV	CS-BNC-TCI	

■ Canare

Canare L-2.5CHWS	NBNC75BFG7X	NBNC75BFG7			1.07	1.6	5.00	●	-	-	-	
Canare L-3CFB, L-3C2VS		NBNC75BHK7					1.6	5.41	●	-	-	-
Canare L-3.3CUHD	NBNC75BLP9X	NBNC75BLP9			1.07	1.6	6.47	●	-	-	-	
Canare L-4CFB	NBNC75BLP9X	NBNC75BLP9		NBNB75GLP9	1.07	1.6	6.47	●	-	-	-	
Canare L-4.5CHD, L-4.5CHWS	NBNC75BTU11X	NBNC75BTU11			1.07	1.6	7.36	●	-	-	-	
Canare L-5CFB		NBNC75BYY11				1.6	8.23	●	-	-	-	
Canare L-5.5 CUHD	NBNC75BZV14X					1.6	8.23	-	●	-	-	
Canare LV-61S	NBNC75BLP7X	NBNC75BLP7			1.07	1.6	6.47	●	-	-	-	
Canare LV-77S		NBNC75BYY9				1.6	8.23	●	-	-	-	
Canare V(3-5)-3C		NBNC75BGG7				1.6	5.00	●	-	-	-	
Canare V(3-5)-4CFB		NBNC75BJJ9				1.6	5.41	●	-	-	-	
Canare V(3-5)-5C		NBNC75BRS9				1.6	7.01	●	-	-	-	
Canare V(3-5)-5CFB		NBNC75BWS11				1.6	7.01	●	-	-	-	
Canare L-1.5C2VS			NBTC75BLI4			1.6	4.06	●	-	-	●	
Canare L-3CFW	NBNC75BLP7X	NBNC75BLP7			1.07	1.6	6.47	●	-	-	-	
Canare L-5CFW		NBNC75BYY11				1.6	8.23	●	-	-	-	

■ Canford

Canford SDV, SDV-X, SDM	NBNC75BFG7X	NBNC75BFG7			1.07	1.6	5.00	●	-	-	-	
Canford SDV-F, SDV-XF		NBNC75BUU11				1.6	7.36	●	-	-	-	
Canford SDV-F-HD		NBNC75BWU13				1.6	7.36	●	-	-	-	
Canford SDV-HD		NBLC75BVZ17				1.8	10.00	-	-	●	-	
Canford SDV-I-X-LFH	NBNC75BLP9X	NBNC75BLP9			1.07	1.6	6.47	●	-	-	-	
Canford SDV-L, SDV-F	NBNC75BUU11X	NBNC75BUU11				1.6	7.01	●	-	-	-	
Canford SDV-M		NBTB75CNN5				1.6	4.53	●	-	-	●	
Canford VCS (BBC PSF1/3)		NBNC75BLS7				1.6	7.01	●	-	-	-	

■ Clark

Clark CD7559-0, CD7559F-0	NBNC75BLP9X	NBNC75BLP9			1.07	1.6	6.47	●	-	-	-	
Clark CD7523-7	NBNC75BDD6X	NBNC75BDD6			1.07	1.6	4.53	●	-	-	●	
Clark CD7506-0	NBNC75BTU11X	NBNC75BTU11			1.07	1.6	7.36	●	-	-	-	
Clark CD7506F-0		NBNC75BRU11				1.6	7.36	●	-	-	-	

■ Commscope

Commscope 2065V		NBNC75BIJ9				1.6	5.41	●	-	-	-	
Commscope 2279V		NBNC75BQP11				1.6	6.47	●	-	-	-	
Commscope 5563	NBNC75BLP7X	NBNC75BLP7			1.07	1.6	6.47	●	-	-	-	
Commscope 5565	NBNC75BLP9X	NBNC75BLP9		NBNB75GLP9	1.07	1.6	6.47	●	-	-	-	
Commscope 5765	NBNC75BTU11X	NBNC75BTU11			1.07	1.6	7.36	●	-	-	-	
Commscope 7536 (03-05)			NBTC75BXX6			1.6	5.00	●	-	-	●	
Commscope 7538	NBNC75BDD6X	NBNC75BDD6			1.07	1.6	4.53	●	-	-	-	

■ Cordial

Cordial CVI 3-7	NBNC75BFG7X	NBNC75BFG7			1.07	1.6	4.53	●	-	-	-	
Cordial CVI 06-28	NBNC75BFG7X	NBNC75BFG7			1.07	1.6	5.00	●	-	-	-	
Cordial CVI 06-28HD, CVI 06-28HD-FRNC	NBNC75BFG7X	NBNC75BFG7			1.07	1.6	5.00	●	-	-	-	
Cordial CVI (CVM) 06-37	NBNC75BLP7X	NBNC75BLP7			1.07	1.6	6.47	●	-	-	-	
Cordial CVI 08-37 HD-FRNC		NBNC75BNP9				1.6	6.47	●	-	-	-	
Cordial CVI 10-48 HD	NBNC75BUU11X	NBNC75BUU11			1.07	1.6	7.36	●	-	-	-	

	rearTWIST UHD	rearTWIST HD	rearTWIST HD Tiny	Cable Jack & Panel	Pin Crimp in mm		Hex Crimp in mm		Stripping Tool			
					UHD	HD			CS-BNC-RT	CS-BNC-LCS	CS-BNC-LCV	+ CS-BNC-TCI
Cordial CVI 10-48 HD-FRNC		NBNC75BWS11				1.6	7.01	●	-	-	-	
Cordial CVM 08-32 HD-FLEX		NBNC75BIJ9				1.6	5.41	●	-	-	-	
Cordial CVM 08-37 UHD-FLEX	NBNC75BJP9X	NBNC75BJP9			1.07	1.6	6.47	●	-	-	-	
Cordial CVM 12-50 HD-FLEX		NBNC75BWU13				1.6	7.36	●	-	-	-	
Cordial CVM 12-50 UHD-FLEX		NBNC75BWU13				1.6	7.36	●	-	-	-	

■ Draka Multimedia Cable

0.31 / 1.45 AF, 753-1304(2), 755-1302			NBTC75BFI4	NBTB75CFI4		1.6	4.06	●	-	-	●	
0.41 / 1.9 AF, 753-1104, 755-1103, 755-1101			NBTC75BNN5	NBTB75CNN5		1.6	4.53	●	-	-	●	
0.51 / 2.3 Dz, 757-1001, VADN 7243			NBTC75BVX6			1.6	5.00	●	-	-	●	
0.6 / 2.8 AF, 0.6 L / 2.8 AF	NBNC75BFG7X	NBNC75BFG7			1.07	1.6	5.00	●	-	-	-	
HD Pro 0.6/2.8 AF	NBNC75BFG7X	NBNC75BFG7			1.07	1.6	5.00	●	-	-	-	
0.6 / 3.7, 0.6L / 3.7	NBNC75BLP7X	NBNC75BLP7			1.07	1.6	6.47	●	-	-	-	
0.6 / 3.7 Dz		NBNC75BLS7				1.6	7.01	●	-	-	-	
0.8 / 3.7 AF, 755-801(803, 804)	NBNC75BLP9X	NBNC75BLP9		NBNB75GLP9	1.07	1.6	6.47	●	-	-	-	
Highflex 08L/3.7D, HD Pro 0.8/3.7 AF	NBNC75BLP9X	NBNC75BLP9			1.07	1.6	6.47	●	-	-	-	
0.8 / 4.9 Dz		NBNC75BXY9				1.6	8.23	●	-	-	-	
1.0 / 4.8 AF, 755-901/5	NBNC75BUU11X	NBNC75BUU11		NBNB75GUU11	1.07	1.6	7.36	●	-	-	-	
1.2L / 4.8Dz, 1.2L / 4.95AF		NBNC75BWU13				1.6	7.36	●	-	-	-	
1.4 / 6.6 AF		NBLC75BSX14				1.75	9.73	-	●	-	-	
1.6 / 7.3AF		NBLC75BVZ17				1.8	10.00	-	-	●	-	
Ultra HD PRO50 UHD	NBNC75BFG7X	NBNC75BFG7			1.07	1.6	5.00	●	-	-	-	

■ Direct Cable

Direct Cable 301-299	NBNC75BLP9X	NBNC75BLP9			1.07	1.6	6.47	●	-	-	-	
Direct Cable 301-330	NBNC75BTU11X	NBNC75BTU11			1.07	1.6	7.36	●	-	-	-	
Direct Cable 301-340		NBNC75BRU11				1.6	7.60	●	-	-	-	
Direct Cable 301-351	NBNC75BFG7X	NBNC75BFG7			1.07	1.6	5.00	●	-	-	-	
Direct Cable 301-361	NBNC75BTU11X	NBNC75BTU11			1.07	1.6	7.36	●	-	-	-	
Direct Cable 360-036	NBNC75BFG7X	NBNC75BFG7			1.07	1.6	5.00	●	-	-	-	
Direct Cable 360-031	NBNC75BFG7X	NBNC75BFG7			1.07	1.6	5.00	●	-	-	-	

■ Kabeltronik

Kabeltronik HFV 1.0/4.8 AF-FRNC		NBNC75BRU11				1.6	7.36	●	-	-	-	
Kabeltronik HFV 0.6/2.8 AF-FRNC	NBNC75BFG7X	NBNC75BFG7			1.07	1.6	5.00	●	-	-	-	
Kabeltronik MVP 5x 0.6/2.8 AF-FRNC	NBNC75BFG7X	NBNC75BFG7			1.07	1.6	5.00	●	-	-	-	

■ KLOTZ

KLOTZ V06/28, V062SH, VMXx75Y	NBNC75BFG7X	NBNC75BFG7			1.07	1.6	5.00	●	-	-	-	
KLOTZ V06/37	NBNC75BLP7X	NBNC75BLP7			1.07	1.6	6.47	●	-	-	-	
KLOTZ V08/37H, VD083SH	NBNC75BLP9X	NBNC75BLP9			1.07	1.6	6.47	●	-	-	-	
KLOTZ V10/48, V10/48H	NBNC75BUU11X	NBNC75BUU11		NBNB75GUU11	1.07	1.6	7.36	●	-	-	-	
KLOTZ V16/72		NBLC75BVZ17				1.8	10.00	-	-	●	-	
KLOTZ VD083LP 0.8L/3.7DZ	NBNC75BJP9X	NBNC75BJP9			1.07	1.6	6.47	●	-	-	-	
KLOTZ VD125LPS		NBNC75BWU13				1.6	7.36	●	-	-	-	
KLOTZ VD167SH-E		NBLC75BVZ17				1.8	10.00	-	-	●	-	

	rearTWIST UHD	rearTWIST HD	rearTWIST HD Tiny	Cable Jack & Panel	Pin Crimp in mm	Hex Crimp in mm	Stripping Tool				
					UHD	HD		CS-BNC-RT	CS-BNC-LCS	CS-BNC-LCV	+ CS-BNC-TCI

■ Nexans

Nexans HF 75 0.6/2.9 02YS(ST)CH	NBNC75BFG7X	NBNC75BFG7			1.07	1.6	5.00	●	-	-	-
Nexans HF 75 1.6/7.2 02Y(ST)C(ST)H		NBNC75BVZ17					1.8	10.00	-	-	●
Nexans HF 75 0.6/3.7 2YCY	NBNC75BLP7X	NBNC75BLP7			1.07	1.6	6.47	●	-	-	-

■ Percon

Percon VK2			NBTC75BNN5			1.6	4.53	●	-	-	●
Percon VK5	NBNC75BFG7X	NBNC75BFG7			1.07	1.6	5.00	●	-	-	-
Percon VK6	NBNC75BLP9X	NBNC75BLP9			1.07	1.6	6.47	●	-	-	-
Percon VK66 ENH	NBNC75BJP9X	NBNC75BJP9			1.07	1.6	6.47	●	-	-	-
Percon VK7	NBNC75BUU11X	NBNC75BUU11			1.07	1.6	7.36	●	-	-	-
Percon VK77	NBNC75BTU11X	NBNC75BTU11			1.07	1.6	7.36	●	-	-	-
Percon VK770F		NBNC75BWU13				1.6	7.36	●	-	-	-
Percon VK8		NBLC75BSX14				1.75	9.73	-	●	-	-
Percon VK9		NBLC75BVZ17				1.8	10.0	-	-	●	-
Percon VK95	NBNC75BLP7X	NBNC75BLP7			1.07	1.6	6.47	●	-	-	-

■ Proel

Proel HPC 805	NBNC75BLP7X	NBNC75BLP7			1.07	1.6	6.47	●	-	-	-
Proel HPC 810	NBNC75BLP9X	NBNC75BLP9			1.07	1.6	6.47	●	-	-	-
Proel HPC 820		NBNC75BFH6				1.6	5.00	●	-	-	-

■ RG

RG11		NBLC75BVZ17				1.8	10.00	-	-	●	-
RG59B/U	NBNC75BLP7X	NBNC75BLP7			1.07	1.6	6.47	●	-	-	-
RG179B/U			NBTC75BLI4			1.6	4.06	●	-	-	●

■ SOMMER

SOMMER 600-0041C			NBTC75NBS4			1.6	4.53	●	-	-	-
SOMMER 600-0051 (M/L/S)	NBNC75BLP7X	NBNC75BLP7			1.07	1.6	6.47	●	-	-	-
SOMMER 600-0054 (M/L/S)	NBNC75BLP7X	NBNC75BLP7			1.07	1.6	6.47	●	-	-	-
SOMMER 600-0101M	NBNC75BFG7X	NBNC75BFG7			1.07	1.6	5.00	●	-	-	-
SOMMER 600-0104M	NBNC75BFG7X	NBNC75BFG7			1.07	1.6	5.00	●	-	-	-
SOMMER 600-0131		NBLC75BSX14				1.75	9.73	-	●	-	-
SOMMER 600-0144	NBNC75BUU11X	NBNC75BUU11			1.07	1.6	7.36	●	-	-	-
SOMMER 600-162(F), Vctor 0.8/3.7	NBNC75BLP9X	NBNC75BLP9			1.07	1.6	6.47	●	-	-	-
SOMMER 600-0174		NBNC75BWU13				1.6	7.36	●	-	-	-
SOMMER 600-0174FC		NBNC75BWU13				1.6	7.36	●	-	-	-
SOMMER 600-0214		NBNC75BWU13				1.6	7.36	●	-	-	-
SOMMER 600-025* -03 (05)			NBTC75BLI5	NBTB75CLI5		1.6	4.06	●	-	-	●
SOMMER 600-0701			NBTC75BLI5	NBTB75CLI5		1.6	4.06	●	-	-	●
SOMMER 600-020* -03 (05)			NBTC75BLI5	NBTB75CLI5		1.6	4.06	●	-	-	●
SOMMER 600-0234		NBLC75BVZ17				1.8	10.00	-	-	●	-
SOMMER 600-0234FC		NBLC75BVZ17				1.8	10.00	-	-	●	-
SOMMER 600-0451	NBNC75BLP9X	NBNC75BLP9		NBNB75GLP9	1.07	1.6	6.47	●	-	-	-
SOMMER 600-0621-05	NBNC75BFG7X	NBNC75BFG7			1.07	1.6	5.00	●	-	-	-
SOMMER 600-0751			NBTC75BVX6			1.6	5.00	●	-	-	●
SOMMER 600-0791	NBNC75BFG7X	NBNC75BFG7			1.07	1.6	5.00	●	-	-	-
SOMMER 600-0851	NBNC75BFG7X	NBNC75BFG7			1.07	1.6	5.00	●	-	-	-
SOMMER 600-0851-05	NBNC75BFG7X	NBNC75BFG7			1.07	1.6	5.00	●	-	-	-

	rearTWIST	rearTWIST	rearTWIST	Cable Jack & Panel	Pin Crimp		Hex Crimp		Stripping			
	UHD	HD	HD Tiny		in mm	in mm	UHD	HD	CS-BNC-RT	CS-BNC-LCS	CS-BNC-LCV	+ CS-BNC-TCI
SOMMER 600-1031		NBNC75BWU13				1.6	7.36	●	-	-	-	
SOMMER 600-1451	NBNC75BFG7X	NBNC75BFG7			1.07	1.6	5.00	●	-	-	-	
-SOMMER 600-2001		NBNC75BWU13				1.6	7.36	●	-	-	-	
SOMMER 600-2031		NBNC75BWU13				1.6	7.36	●	-	-	-	
SOMMER 600-2101	NBNC75BFG7X	NBNC75BFG7			1.07	1.6	5.00	●	-	-	-	
SOMMER 600-2231	NBNC75BLP9X	NBNC75BLP9			1.07	1.6	6.47	●	-	-	-	
SOMMER 600-2781		NBNC75BWU13				1.6	7.36	●	-	-	-	
SOMMER 600-2791		NBNC75BWU13				1.6	7.36	●	-	-	-	
SOMMER 600-2811-01		NBNC75BWU13				1.6	7.36	●	-	-	-	
SOMMER 600-3202		NBNC75BWU13				1.6	7.36	●	-	-	-	
SOMMER 605-0761	NBNC75BFG7X	NBNC75BFG7			1.07	1.6	5.00	●	-	-	-	
■ Suhner												
Suhner G02233			NBTC75BF14	NBTB75CF14		1.6	4.06	●	-	-	●	
Suhner G04233D		NBNC75BLS7				1.6	7.01	●	-	-	-	
Suhner S02223			NBTC75BL14			1.6	4.06	●	-	-	●	
Suhner S04233, S04263	NBNC75BLP9X	NBNC75BLP9		NBNB75GLP9	1.07	1.6	6.47	●	-	-	-	
Suhner S05133-07	NBNC75BTU11X	NBNC75BTU11			1.07	1.6	7.36	●	-	-	-	
Suhner S05163-02	NBNC75BTU11X	NBNC75BTU11			1.07	1.6	7.36	●	-	-	-	
■ Tasker												
Tasker RGB75			NBTC75BF14			1.6	4.06	●	-	-	-	
Tasker RG59BU		NBNC75BLP7				1.6	6.47	●	-	-	-	
Tasker RG11AU		NBLC75BVZ17				1.8	10.00	-	-	●	-	
Tasker TSK1077LSZH		NBNC75BFG7				1.6	5.00	●	-	-	-	
Tasker TSK1078LSZH	NBNC75BLP9X	NBNC75BLP9				1.6	6.47	●	-	-	-	
Tasker TSK1079LSZH	NBNC75BTU11X	NBNC75BTU11			1.07	1.6	7.36	●	-	-	-	
Tasker TSK1080LSZH		NBLC75BVZ17				1.8	10.00	-	-	●	-	
Tasker T42 PVC		NBNC75BWU13				1.6	7.36	●	-	-	-	
Tasker T42 PUR		NBNC75BWU13				1.6	7.36	●	-	-	-	
■ Tesca												
Tesca Bachelor		NBNC75BWU13				1.6	7.36	●	-	-	-	
Tesca Bachelor PUR		NBNC75BZV14				1.6	8.23	-	●	-	-	
Tesca Bengal			NBTC75BNS4			1.6	4.53	●	-	-	●	
Tesca DUBLO V		NBNC75BWU13				1.6	7.36	●	-	-	-	
Tesca Fabio 12G		NBNC75BUU11				1.6	7.36	●	-	-	-	
Tesca KXV6		NBNC75BLP7				1.6	6.47	●	-	-	-	
Tesca Supra	NBNC75BFG7X	NBNC75BFG7			1.07	1.6	5.00	●	-	-	-	
Tesca Massimo		NBLC75BSX14				1.75	9.73	-	●	-	-	
Tesca Sphere		NBLC75BVZ17				1.8	10.00	-	-	●	-	
Tesca Presto		NBNC75BJP9				1.6	6.47	●	-	-	-	
Tesca Prima		NBNC75BTS11				1.6	7.01	●	-	-	-	
Tesca Linea		NBNC75BNP9				1.6	6.47	●	-	-	-	
Tesca Vostok		NBNC75BWS12				1.6	7.01	●	-	-	-	
Tesca Dublo		NBNC75BWS12				1.6	7.01	●	-	-	-	



	rearTWIST UHD	rearTWIST HD	rearTWIST HD Tiny	Cable Jack & Panel	Pin Crimp in mm		Hex Crimp in mm	Stripping Tool							
					UHD	HD		CS-BNC-RT	CS-BNC-LCS	CS-BNC-LCV	+ CS-BNC-TCI				

■ Van Damme

Van Damme 268-175-000	NBNC75BUU11X	NBNC75BUU11			1.07	1.6	7.36	●	-	-	-				
Van Damme 268-275-000	NBNC75BJP9X	NBNC75BJP9			1.07	1.6	6.47	●	-	-	-				
Van Damme 268-306-000	NBNC75BLP9X	NBNC75BLP9			1.07	1.6	6.47	●	-	-	-				
Van Damme 268-408-000			NBTC75BFI4			1.6	6.47	●	-	-	●				
Van Damme 268-475-000	NBNC75BTU11X	NBNC75BTU11			1.07	1.6	7.36	●	-	-	-				
Van Damme 268-675-000	NBNC75BTU11X	NBNC75BTU11			1.07	1.6	7.36	●	-	-	-				
Van Damme 278-475-000		NBLC75BVZ17				1.8	10.00	-	-	●	-				
Van Damme 278-175-000	NBNC75BUU11X	NBNC75BUU11			1.07	1.6	7.36	●	-	-	-				
Van Damme 278-975-000	NBNC75BLP9X	NBNC75BLP9			1.07	1.6	6.47	●	-	-	-				
Van Damme 278-775-000			NBTC75BSS5			1.6	4.53	●	-	-	●				
Van Damme 278-075-000	NBNC75BFG7X	NBNC75BFG7			1.07	1.6	5.00	●	-	-	-				
Van Damme 278-075-006	NBNC75BFG7X	NBNC75BFG7			1.07	1.6	5.00	●	-	-	-				
Van Damme 278-375-000	NBNC75BUU11X	NBNC75BUU11			1.07	1.6	7.36	●	-	-	-				

■ Others

AT&T 735			NBTC75BSS5			1.6	4.53	●	-	-	●				
COMM-TEC RGBHV			NBTC75BSS5			1.6	4.53	●	-	-	●				
BBC PSF 1/3*		NBNC75BLS7				1.6	7.01	●	-	-	-				
COVID CVD 1300-1500			NBTC75BLI5	NBTB75CLI5		1.6	4.06	●	-	-	●				
Eupen 705 CRT 5V-HS		NBNC75BTS11				1.6	7.36	●	-	-	-				
Extron BNC-5HR			NBTC75BNN5	NBTB75CNN5		1.6	4.53	●	-	-	●				
Extron BNC-5SRC	NBNC75BFG7X	NBNC75BFG7			1.07	1.6	5.00	●	-	-	-				
GEPCO VDM230	NBNC75BDD6X	NBNC75BDD6			1.07	1.6	4.53	●	-	-	-				
GEPCO VPM2000	NBNC75BLP9X	NBNC75BLP9		NBNB75GLP9	1.07	1.6	6.47	●	-	-	-				
GEPCO VSD2001	NBNC75BTU11X	NBNC75BTU11			1.07	1.6	7.36	●	-	-	-				
Helix 734		NBNC75BNP9				1.6	6.47	●	-	-	-				
Helix 735			NBTC75BSS5			1.6	4.53	●	-	-	●				
Hirschmann KOKA 712Cu		NBNC75BTS9				1.6	6.47	●	-	-	-				
Kansai 3C-5S		NBNC75BFH6				1.6	5.00	●	-	-	-				
Kelsey SD-1	NBNC75BFG7X	NBNC75BFG7			1.07	1.6	5.00	●	-	-	-				
Kelsey SD-1-LL		NBNC75BWS11				1.6	7.01	●	-	-	-				
KROSCHU (341 270, 341 280)			NBTC75BLI4		1.6	4.06	●	-	-	●	-				
Pro Plex RG6 TMB	NBNC75BUU11X	NBNC75BUU11			1.07	1.6	7.36	●	-	-	-				
Pro Plex RG11		NBLC75BVZ17				1.8	10.00	-	-	●	-				
Pro Plex RG59	NBNC75BUU11X	NBNC75BUU11			1.07	1.6	7.36	●	-	-	-				
Quadtronics CABPGHD70MW-500		NBNC75BFG7			1.07	1.6	5.00	●	-	-	-				
Wisi MK 99A		NBNC75BWS12				1.6	6.47	●	-	-	-				
ZNK CM14B			NBTC75BFI4	NBTB75CFI4		1.6	4.06	●	-	-	●				

* Registered trademark of BBC

	Inner Conductor	Insulator	Cable O.D. mm	Pin crimp mm (square)	Hex Crimp mm	Stripping Tool			
						CS-BNC-RT	CS-BNC-LCS	CS-BNC-LCV	+ CS-BNC-TCI

rearTWIST HD & UHD

NBLC75BVZ17	< 1.7	< 8.0	< 10.4	1.80 (Hex crimp)	10.00	-	-	●	-
NBLC75BSX14	< 1.4	< 6.6	< 9.5	1.75 (Hex crimp)	9.73	-	●	-	-
NBNC75BDD6	< 0.6	< 2.8	< 4.3	1.6	4.53	●	-	-	-
NBNC75BDD6X	< 0.6	< 2.8	< 4.3	1.07	4.53	●	-	-	-
NBNC75BFG7	< 0.7	< 3.1	< 4.7	1.6	5.00	●	-	-	-
NBNC75BFG7X	< 0.7	< 3.1	< 4.7	1.07	5.00	●	-	-	-
NBNC75BFH6	< 0.6	< 3.1	< 4.9	1.6	5.00	●	-	-	-
NBNC75BGG7	< 0.7	< 3.2	< 4.7	1.6	5.00	●	-	-	-
NBNC75BHK7	< 0.7	< 3.3	< 5.6	1.6 (or 1.75 Hex)	5.41	●	-	-	-
NBNC75BIJ9	< 0.9	< 3.6	< 5.3	1.6	5.41	●	-	-	-
NBNC75BIJ9	< 0.9	< 3.8	< 5.3	1.6	5.41	●	-	-	-
NBNC75BJP9	< 0.9	< 3.8	< 6.3	1.6	6.47	●	-	-	-
NBNC75BJP9X	< 0.9	< 3.8	< 6.3	1.07	6.47	●	-	-	-
NBNC75BLP7	< 0.7	< 3.8	< 6.3	1.6	6.47	●	-	-	-
NBNC75BLP7X	< 0.7	< 3.8	< 6.3	1.07	6.47	●	-	-	-
NBNC75BLP9	< 0.9	< 3.8	< 6.3	1.6	6.47	●	-	-	-
NBNC75BLP9X	< 0.9	< 3.8	< 6.3	1.07	6.47	●	-	-	-
NBNC75BLS7	< 0.7	< 3.8	< 6.9	1.6	7.01	●	-	-	-
NBNC75BNP9	< 0.9	< 4.1	< 6.3	1.6	6.47	●	-	-	-
NBNC75BQP11	< 1.1	< 4.5	< 6.3	1.6	6.47	●	-	-	-
NBNC75BQP11X	< 1.1	< 4.5	< 6.3	1.07	6.47	●	-	-	-
NBNC75BRS9	< 0.9	< 4.8	< 6.9	1.6	7.01	●	-	-	-
NBNC75BTS9	< 0.9	< 4.7	< 6.9	1.6	7.01	●	-	-	-
NBNC75BTS11	< 1.1	< 4.7	< 6.9	1.6	7.01	●	-	-	-
NBNC75BTU11	< 1.1	< 4.7	< 7.3	1.6	7.36	●	-	-	-
NBNC75BTU11X	< 1.1	< 4.7	< 7.3	1.07	7.36	●	-	-	-
NBNC75BTUP11X	< 1.1	< 4.7	< 7.3	1.07	7.06	●	-	-	-
NBNC75BTU13	< 1.4	< 4.7	< 7.3	1.6	7.36	●	-	-	-
NBNC75BUU11	< 1.1	< 4.9	< 7.3	1.6	7.36	●	-	-	-
NBNC75BUU11X	< 1.1	< 4.9	< 7.3	1.07	7.36	●	-	-	-
NBNC75BRU11	< 1.1	< 4.8	< 7.3	1.6	7.36	●	-	-	-
NBNC75BWS11	< 1.1	< 5.1	< 6.9	1.6	7.01	●	-	-	-
NBNC75BWS12	< 1.2	< 5.1	< 6.9	1.6	7.01	●	-	-	-
NBNC75BWU13	< 1.4	< 5.1	< 7.3	1.6	7.36	●	-	-	-
NBNC75BXU13	< 1.4	< 5.3	< 7.3	1.6	7.36	●	-	-	-
NBNC75BXY9	< 0.9	< 5.3	< 8.0	1.6	8.23	●	-	-	-
NBNC75BYY9	< 0.9	< 5.2	< 8.0	1.6	8.23	●	-	-	-
NBNC75BYY11	< 1.1	< 5.2	< 8.0	1.6	8.23	●	-	-	-
NBNC75BZV14	< 1.4	< 5.2	< 8.2	1.6 (or 1.75 Hex)	8.23	●	-	-	-
NBNC75BZV14X	< 1.4	< 5.2	< 8.2	1.6 (or 1.75 Hex)	8.23	●	-	-	-
NBNC75BXU13X	< 1.4	< 5.3	< 7.3	1.6	7.36	●	-	-	-

	Inner Conductor	Insulator	Cable O.D. mm	Pin crimp mm (square)	Hex Crimp mm	Stripping Tool			
						CS-BNC-RT	CS-BNC-LCS	CS-BNC-LCV	+ CS-BNC-TCI

rearTWIST TINY

NBTC75BFI4	< 0.4	< 1.6	< 2.9	1.6	4.06	•	-	-	•
NBTC75BLI4	< 0.4	< 1.8	< 2.9	1.6	4.06	•	-	-	•
NBTC75BLI5	< 0.5	< 1.8	< 2.9	1.6	4.06	•	-	-	•
NBTC75BNN5	< 0.5	< 2.0	< 3.1	1.6	4.53	•	-	-	•
NBTC75BNS4	< 0.4	< 2.0	< 3.5	1.6	4.53	•	-	-	•
NBTC75BSS5	< 0.5	< 2.3	< 3.4	1.6	4.53	•	-	-	•
NBTC75BVV5	< 0.5	< 2.5	< 3.8	1.6	5.00	•	-	-	•
NBTC75BVX6	< 0.6	< 2.5	< 4.0	1.6	5.00	•	-	-	•
NBTC75BXX5	< 0.5	< 2.6	< 4.0	1.6	5.00	•	-	-	•
NBTC75BXX6	< 0.6	< 2.6	< 4.0	1.6	5.00	•	-	-	•

CABLE JACKS (TINY & PANEL VERSION)

NBTB75CFI4	< 0.4	< 1.6	< 2.9	1.6	4.06	•	-	-	•
NBTB75CNN5	< 0.5	< 2.0	< 3.1	1.6	4.53	•	-	-	•
NBTB75CLI5	< 0.5	< 1.8	< 2.9	1.6	4.06	•	-	-	•
NBNB75GLP9	< 0.9	< 3.8	< 6.3	1.6	6.47	•	-	-	•
NBNB75GUU11	< 1.1	< 4.9	< 7.3	1.6	7.36	•	-	-	•
NBNB75ILP9	< 0.9	< 3.8	< 6.3	1.6	6.47	•	-	-	•
NBNB75IUU11	< 1.1	< 4.9	< 7.3	1.6	7.36	•	-	-	•


NEUTRIK®

The premium brand of the Neutrik Group

LIECHTENSTEIN (HEADQUARTERS)

Neutrik AG, Im alten Riet 143, 9494 Schaan

T +423 237 24 24, F +423 232 53 93, neutrik@neutrikgroup.com

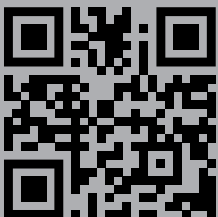

www.neutrik.com